


Assembly Instructions

- 1) Attach *Strain Relief (B)* to *Plastic Enclosure (C)*.
- 2) Pass *Cable (A)* through *Strain Relief (B)*/*Plastic Enclosure (C)* assembly, *Metal Spring (D)*, and *Plastic Guide Ring (E)*.
- 3) Solder cable wires to solder cups on *Pin Mold (G)*.
- 4) Properly align *Pin Mold (G)* with *Lower Metal Sleeve (H)*. The slotted sections on the sides of the *Pin Mold (G)* must line up with the slotted cut-outs on the *Lower Metal Sleeve (H)* and the 3 semi-circular notches around the perimeter of the *Pin Mold (G)* must line up with the 3 metal tabs inside the *Lower Metal Sleeve (H)*.
- 5) Push *Pin Mold (G)* forward into the *Lower Metal Sleeve (H)* until it locks into place.
- 6) ***IMPORTANT*** Manually press the 3 metal tabs on the *Lower Metal Sleeve (H)* all the way into the notches in the *Pin Mold (G)* until they rest on the plastic.
- 7) Crimp 'U' section of *Lower Metal Sleeve (H)* onto *Cable (A)*.
- 8) Fit *Plastic Ring Guide (E)* into *Lower Metal Sleeve (H)* by placing plastic arms into the appropriate slots on the sides of the sleeve.
- 9) Attach *Top Metal Cover (F)* onto *Lower Metal Sleeve (H)*. Be sure to align all tabs and securely install cover.
- 10) Push *Metal Spring (D)* onto the *Top Metal Cover (F)*/*Lower Metal Sleeve (H)* assembly. This will help to hold the assembly together.
- 11) Push *Strain Relief (B)*/*Plastic Enclosure (C)* assembly onto the *Top Metal Cover (F)*/*Lower Metal Sleeve (H)* assembly. The two assemblies must be properly aligned as shown in the drawing. Be sure to check that the *Metal Spring (D)* remains in place and does not go underneath either the *Plastic Enclosure (C)* or the *Plastic Guide (E)* or twists during assembly. A significant amount of force may be necessary to lock the two assemblies together.
- 12) Press metal tab located on Top metal Cover (F) into gap in Plastic Enclosure (C)
- 13) Check to make sure that the *Strain Relief (B)*/*Plastic Enclosure (C)* assembly is securely locked into place over the *Top Metal Cover (F)*/*Lower Metal Sleeve (H)* assembly. The two assemblies should not be able to be pulled apart.
- 14) Properly align the new assembly with the *Plastic Coupling (I)* as shown in the drawing. Push assembly (twisting plastic enclosure "C" part) into *Plastic Coupling (I)* until it locks properly into place. The entire plug assembly is now complete.

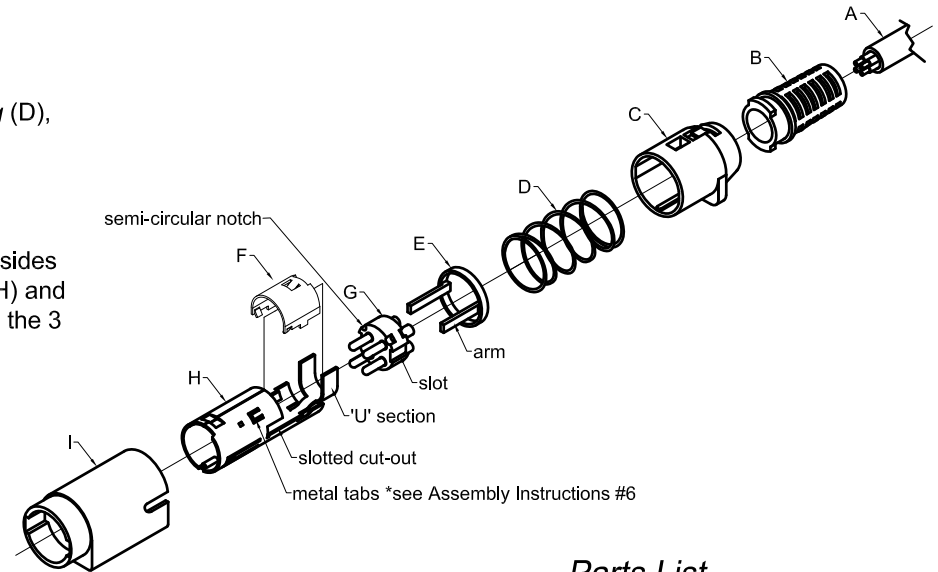

Parts List

- A - Customer Cable
- B - Strain Relief
- C - Plastic Enclosure
- D - Metal Spring
- E - Plastic Guide
- F - Top Metal Cover
- G - Pin Mold
- H - Lower Metal Sleeve
- I - Plastic Coupling



REV.	DATE	DESCRIPTION	REV. BY	CHK. BY	DRAWN BY	DATE
A2	11/29/06	ECO #06-051	R. Aguirre	H. Ma		
A3	07/24/07	ECO #07-028	A. Frederick	R. Aguirre	H. MA	9/21/05
B1	01/24/11	ECO #11-007	P. DalCanto	H. MA		
B2	04/30/14	ECO #14-018	W. Cook	H. MA		
B3	05/14/15	Add Clarity to #6	C. Kelleher	W. Cook		
B4	08/03/18	Address Update	G. Serrato	D. Shehan		

KPPX Series Assembly

KPPX Series Assembly

Parts List & Instructions

